

SERVICE BULLETIN

Original Issue Date: 6/10

Model: 30RESA and 30REYG

Market: Residential/Commercial

Subject: Air Intake Resonator Kit GM75873 for LP-Fueled Generator Sets

Kohler has determined that some Model 30RESA and 30REYG generator sets with specification numbers starting with GM69190 may experience hard starting when operated on LP fuel. An air intake resonator and revised engine ECM software have been released to resolve this issue.

All 30RESA and 30REYG with specification numbers beginning with GM69190 and operating on LP fuel are affected.

Note: Only units running on LP gas need this kit installed.

Generator sets with specification numbers starting with GM74628 have factory-installed resonator boxes and do not require the service kit.

If you do not have the engine ECM troubleshooting/reprogramming tool GM42033, it will be necessary to purchase it to perform the installation of the engine ECM software.

For units installed and operating on LP fuel, install the service kit and ECM software update at your earliest convenience. If the air cleaner was modified prior to the availability of this kit, please install a replacement air cleaner assembly GM36199 during the kit installation. For units currently not in service, install the kit and update the ECM software either during the startup inspection or prior to the unit being received by the owner.

To obtain the new ECM file for each specific unit being updated, please contact the Kohler Power Systems Generator Field Service Department at 920-459-1775 or email generatorfieldservice@kohler.com. Please provide the unit serial number to obtain the correct calibration for your unit.

Refer to TT-1549 for instructions to install the air intake resonator service kit and reprogram the engine ECM. TT-1549 is provided with service kit GM75873. See Figure 1 for an illustration of the installed kit.

Warranty Claim Information

Use original molded air intake hose part number GM69244 as the primary failed part. Use flat rate 10659 (air intake hose R&R) and 1.0 hr.

Normal travel time and mileage will be allowed for units that were placed in service prior to the release of this bulletin. Travel/mileage will not be allowed for units updated during startup or prior to sale to the customer.

Warranty claims must be filed by June 10, 2012.

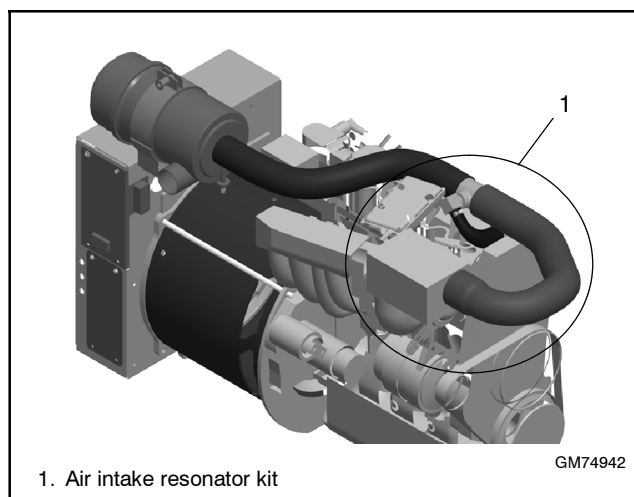


Figure 1 Air Intake Resonator Kit, Installed

Routing	Service Manager	Sales Manager	Parts Manager	Technician No. 1	Technician No. 2	Technician No. 3	Return This to
Initial Here							